ILS RWY 22

REDMOND/ROBERTS FIELD (RDM)

LOC I-RDM	APP CRS	Rwy Idg	7040
109.1	222°	TDZE	3062
		Apt Elev	3077

For inoperative MALSR, increase S-ILS 22 Cat. E visibility to ¾.
For inoperative MALSR, increase S-LOC 22 Cat. E visibility to 1¼ .

MALSR

MISSED APPROACH: Climb to 3500 then climbing right turn direct DSD VORTAC and continue climb to 7000 in DSD VORTAC holding pattern. (TACAN aircraft continue to 8000 to HERBS/10 DME via DSD R-348 and hold.)

ASOS	SEATTLE CENTER	REDMOND TOWER*	GND CON	UNICOM
119.025	128.15 257.75	124.5 (CTAF) L	121.8	122.95

DME OR ADF REQUIRED

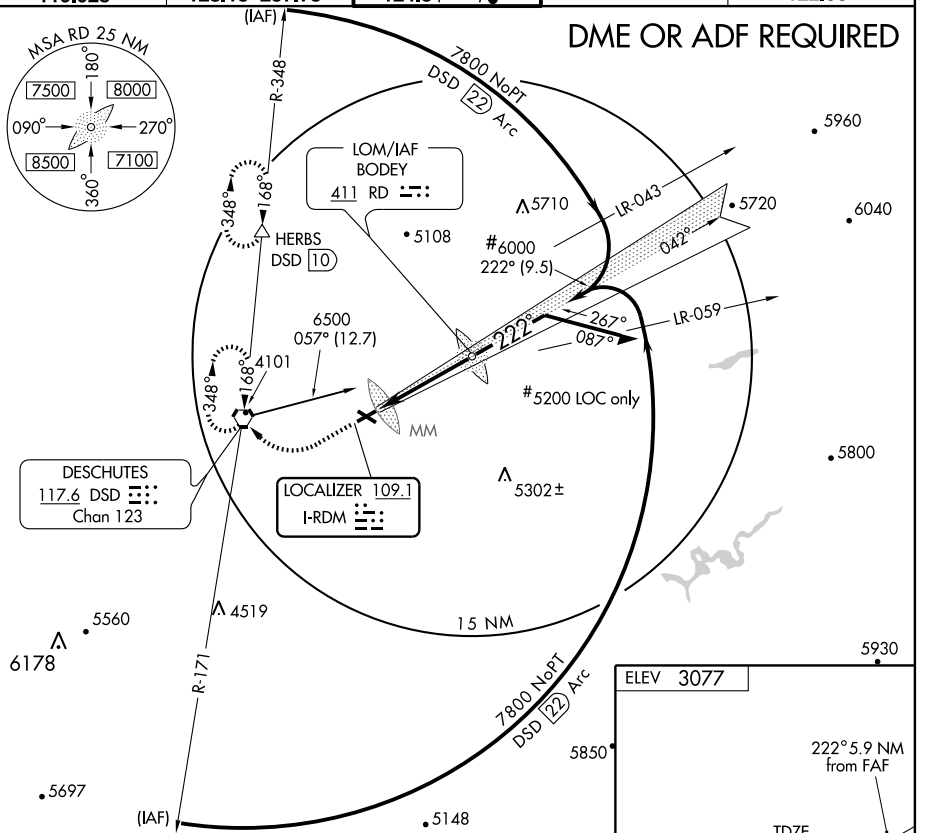

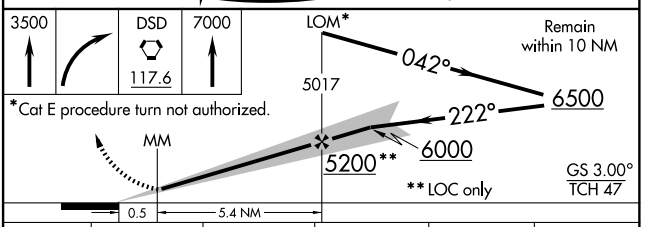

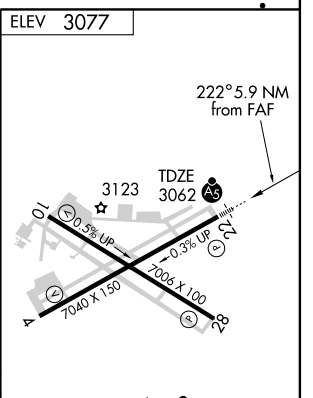

CATEGORY	A	B	C	D	E
S-ILS 22	3262-½ 200 (200-½)				
S-LOC 22	3440-½ 378 (400-½)			3440-¾ 378 (400-¾)	
CIRCLING	3540-1 463 (500-1)		3640-1½ 563 (600-1½)	3640-2 563 (600-2)	3660-2 583 (600-2)

REIL Rwys 4, 10 and 28 L
HIRL Rwy 4-22 L
MIRL Rwy 10-28 L

FAF to MAP 5.9 NM

Knots	60	90	120	150	180
Min:Sec	5:54	3:56	2:57	2:22	1:58

NW-1,20 JAN 2005

NW-1,20 JAN 2005